

# **Concentric Clamping Elements**

2 and 3-point interior clamping, for interchangeable clamping jaws  $\emptyset$  16 – 121 mm, double acting, max. operating pressure 250 bar



## **Application**


This hydraulically-operated concentric clamping element can be equipped with especially low clamping jaws to receive workpieces with interior centrings of low depth.

Suitable workpieces can directly rest on the clamping jaws so that additional support points are not required.

With a combination of 2 and 3-point elements, workpieces with 2 centring holes can be exactly positioned.

### **Description**

The 2 or 3 base jaws are coupled to a coneshaped contact bolt in the centre of the housing, that is driven by a double acting hydraulic piston.



To obtain the required synchronization accuracy all parts are manufactured with high precision. The nitrated base jaws have 3 fixing threads. Depending on the desired centring diameter, the accordingly adjusted clamping jaws can always by fixed with at least 2 screws.

The exact position of the clamping jaws is secured with 2 drill bushings.

## Important notes

The concentric clamping elements are not only suitable for the use on turning machines.

If a workpiece is clamped by one concentric clamping element only, a tilting torque is produced by radial machining forces. Please pay attention to the chapter "Admissible machining forces" on page 2.

In the effective area of the clamping jaws there is the danger of crushing. The manufacturer of the fixture or the machine is obliged to provide effective protection devices.

#### **Advantages**

- Ideal for 5-sided machining
- Suitable for low centring depths
- Clamping jaws can be adapted to the workpiece
- Workpiece support on clamping jaws possible
- Centring repeatability 0.02 mm
- Stroke of clamping jaws 10 mm
- Connection for positive air pressure protection
- Pneumatic stroke end control
- Optional pneumatic contact control

## Positive air pressure connection

The standard positive air pressure protection keeps the hole centre free of swarf, so that the base jaws can freely return.

## Pneumatic stroke end control

The positive air pressure protection can also be used for the control of the unclamping position. The returning clamping jaws close in their end position the bore hole of the positive air pressure connection.

## **Optional contact control**

In the version with contact control, pneumatic pressure is supplied to one of the base jaws, which is then transmitted into the clamping jaw. In the crowned clamping surface there is a small bore hole. If a workpiece is clamped correctly, it closes the bore hole.

## Signal conversion: Pneumatic - electric

An electro-pneumatic measuring device can either signal the pressure increase or a drop of the air flow rate.

1. Pressure switch

The pressure switch signals the pressure increase when closing a blow hole. It is important that the pressure difference between open and closed blow hole is big enough to get a process-safe message.


2 Flow meter


The flow meter signals the drop of the air flow rate when closing a blow hole.

The flow meter should have a digital display and one adjustable limit switch (e.g. type SFAB of FESTO).

The switching threshold is set to a mean value between open and closed nozzle.

We recommend flow measurement, if only one pneumatic line is available for several elements.

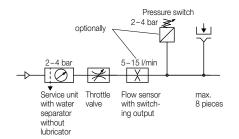

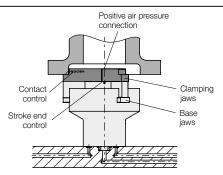


## **Applications**


• Centre and clamp in 1 bore hole




• Centre and clamp in 2 bore holes




• Diagonally centre and clamp in 2 bore holes




• Centre and clamp in longitudinal holes



• Multiple clamping fixture



## Technical data and dimensions Admissible machining forces

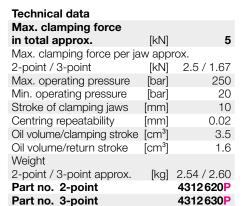

P = Pneumatic contact control (optional)


Admissible machining forces


#### 2-point 3-point 4312620P 4312630P Drill bushings M5 x 20 A 5 x 8 DIN179 Ø 100 Ø 100 $92.5 \pm 0.1$ $92,5 \pm ($ 82.5 82,5 depth 35 52 depth 35 4 x M 6 4 x M 6 12 deep Ø 16 i6 Ø 60 g6 Ø 60 g6


Included in our delivery:


1 x O-ring 17.17 x 1..78 (3000 663)

3 x O-ring 5 x 1.5 (3000 340)

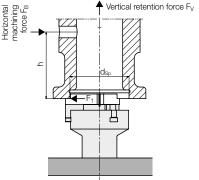

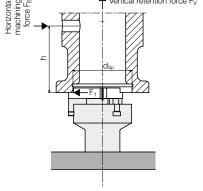

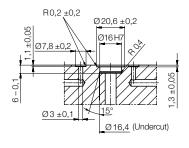

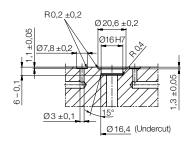

## Vertical retention force

The concentric clamping element generates only horizontal clamping forces. Vertical (uplift) retention forces can only be transmitted non-positively by friction.


The largest vertical retention force is

	$F_V = \mu * F_{Sp}$	[kN]
with $\mu$ ~ 0.2:	$F_V \sim 0.2 * F_{Sp}$	[kN]


## Admissible horizontal machining force


Depending on the height of attack of the machining force over the support surface, a tilting torque is generated and thus also a vertical uplift force, which has to be compensated non-positively by friction between the clamping jaw and the workpiece. In the most unfavourable angle position, the admissible machining

$$F_{Badm} \le \frac{F_1 * 0.75 d_{Sp} * \mu}{h} \le F_1$$
 [kN]

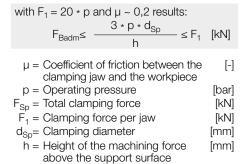



If the machining forces are higher, the workpiece can be supported on the side. The concentric clamping element can also be used to only centre a workpiece and to clamp with additional elements on external fixed points.

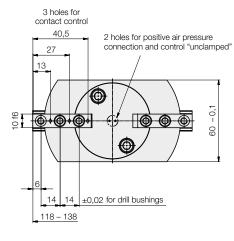

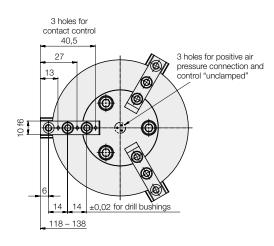

### Connecting scheme

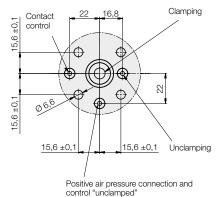

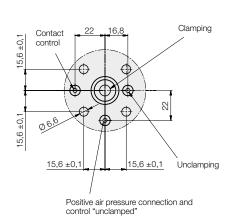

## Clamping jaws for manufacturing dimensions

for clamping Ø 17 – 35 mm (4312620 P)

for clamping Ø 103 – 121 mm (4312630 P)

